


SERVICE BULLETIN

SUBJECT: Barrels of architectural sex bolts *may* come into contact with shim plate and causing an improper fit or *may* cause excess vibration on lock. This occurs on certain wood doors which are less than 1.75" thick or when sex bolt screw has been over-torqued and wood door is compressed.


SERVICE RECOMMENDED:

Repair shim plate by drilling 3 - 13/32" holes through plate. This will provide for ample headspace at end of architectural sex bolt barrel. Alternatively, shim plates may be exchanged for a new one by contacting us at service@teacherlock.com

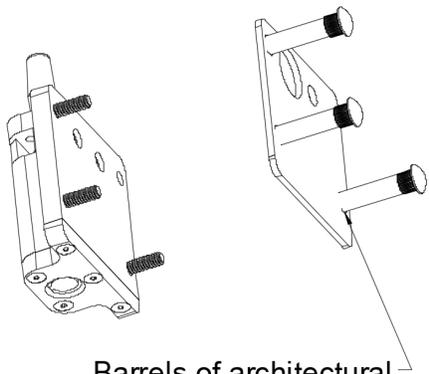

Barrels of architectural bolts should NOT come into contact with shim plate on occupancy side of door.

Drill $\frac{13}{32}$ inch hole
in shim plate
in three (3) places.

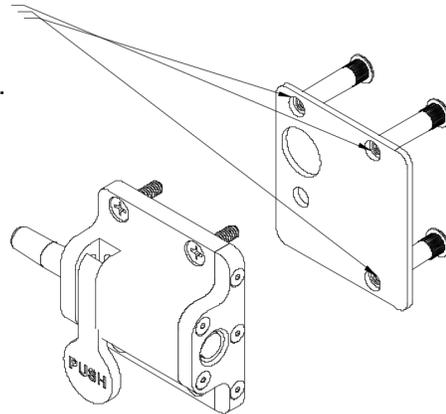

For technical support, please email: service@teacherlock.com Or call:
978-286-8855 For spare parts or additional keys, please visit our website at:
www.teacherlock.com

TeacherLock is a product of DefCon Products, LLC. 808 Main Street, Fitchburg MA 01420